
21 Diagnostic adapters SCA


Diagnostic adapter SCA

Diagnostic adapters

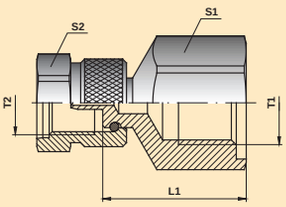


Order code	PN	Pmax	Pburst	T1	T2	L1	S1	S2
SCA-1/4-EMA-3	630 bar	1,200 bar	2,000 bar	1/4" BSPP	M16x2	32	27	22
SCA-1/2-EMA-3	630 bar	800 bar	1,200 bar	1/2" BSPP	M16x2	36	30	22
SCA-1/2-EMA-3-HP	630 bar	1,200 bar	2,000 bar	1/2" BSPP	M16x2	36	32	22

90° diagnostic adapter with measuring coupling

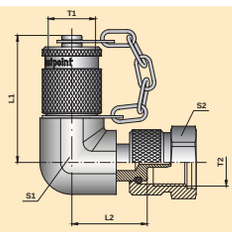


Order code	PN	Pmax	Pburst	T1	T2	L1	L2	S1	S2
SCA-90-EMA-3	630 bar	800 bar	1,200 bar	M16x2	M16x2	52	28.5	19	22


Diagnostic coupling

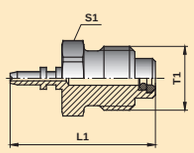


SCA-EMA-3/1

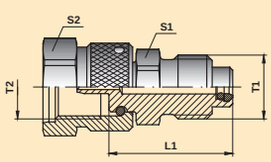

SCA-EMA-3/2

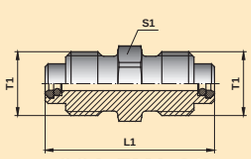

SCA-EMA-3/3

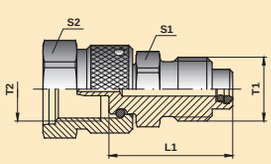

SCA-EMA-3/4

Order code	PN	Pmax	Pburst	T1	T2	L1	S1	S2
SCA-EMA-3/1	630 bar	800 bar	1,200 bar	M16x2	—	37	17	—
SCA-EMA-3/2	630 bar	800 bar	1,200 bar	M16x2	M12x1.65	31	17	22
SCA-EMA-3/3	630 bar	800 bar	1,200 bar	M16x2	M16x2	43	17	—
SCA-EMA-3/4	630 bar	800 bar	1,200 bar	M16x2	M16x1.5	31	17	22


Note pressure ranges!

Adapters may only be used in connection with products listed in this catalog.


Tel: +45 63 12 83 00 | Email: ps@hymatik.com | www.hymatik.com | Hvidkaervej 27a, DK-5250 Odense SV, Denmark

21 Diagnostic adapters SCA

Technical data and order codes

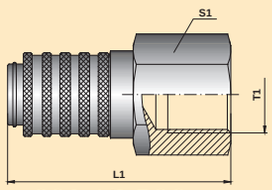

SCA-1/2-PQC

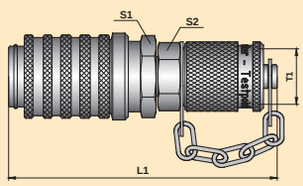

SCA-EMA-3/PQC

Parker diagnostic quick-connection coupling

Order code	PN	Pmax	Pburst	T1	L1	S1	S2
SCA-1/4-PQC	400 bar	600 bar	1,000 bar	1/4" BSPP	—	—	—
SCA-1/2-PQC	400 bar	600 bar	1,000 bar	1/2" BSPP	59	27	—
SCA-EMA-3/PQC	400 bar	600 bar	1,000 bar	M16x2	78	21	17

Note pressure ranges!

Adapters may only be used in connection with products listed in this catalog.

Tel: +45 63 12 83 00 | Email: ps@hymatik.com | www.hymatik.com | Hvidkaervej 27a, DK-5250 Odense SV, Denmark