


21 Diagnostic adapters SCA

Diagnostic adapter SCA


Diagnostic adapters									
Order code	PN	Pmax	Pburst	T1	T2	L1	S1	S2	
SCA-1/4-EMA-3	630 bar	1,200 bar	2,000 bar	1/4" BSPP	M16x2	32	27	22	
SCA-1/2-EMA-3	630 bar	800 bar	1,200 bar	1/2" BSPP	M16x2	36	30	22	
SCA-1/2-EMA-3-HP	630 bar	1,200 bar	2,000 bar	1/2" BSPP	M16x2	36	32	22	

90° diagnostic adapter with measuring coupling									
Order code	PN	Pmax	Pburst	T1	T2	L1	L2	S1	S2
SCA-90-EMA-3	630 bar	800 bar	1,200 bar	M16x2	M16x2	52	28.5	19	22


Diagnostic coupling									
Order code	PN	Pmax	Pburst	T1	T2	L1	S1	S2	
SCA-EMA-3/1	630 bar	800 bar	1,200 bar	M16x2	—	37	17	—	
SCA-EMA-3/2	630 bar	800 bar	1,200 bar	M16x2	M12x1.65	31	17	22	
SCA-EMA-3/3	630 bar	800 bar	1,200 bar	M16x2	M16x2	43	17	—	
SCA-EMA-3/4	630 bar	800 bar	1,200 bar	M16x2	M16x1.5	31	17	22	

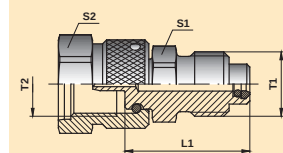

SCA-EMA-3/1

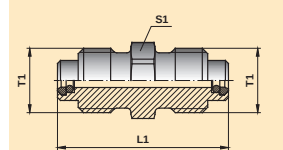

SCA-EMA-3/2

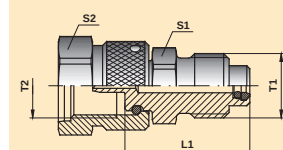

SCA-EMA-3/3



SCA-EMA-3/4




Note pressure ranges!

Adapters may only be used in connection with products listed in this catalog.




21 Diagnostic adapters SCA

Technical data and order codes

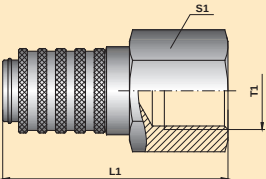

SCA-1/2-PQC

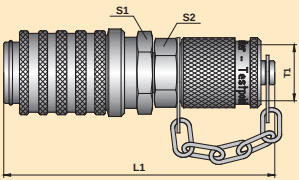

SCA-EMA-3/PQC

Parker diagnostic quick-connection coupling

Order code	PN	Pmax	Pburst	T1	L1	S1	S2
SCA-1/4-PQC	400 bar	600 bar	1,000 bar	1/4" BSPP	—	—	—
SCA-1/2-PQC	400 bar	600 bar	1,000 bar	1/2" BSPP	59	27	—
SCA-EMA-3/PQC	400 bar	600 bar	1,000 bar	M16x2	78	21	17



Note pressure ranges!

Adapters may only be used in connection with products listed in this catalog.

